

febi 193068 193076

To Fit: Porsche 911 (997) 2004 > 2013,
Boxster (987) 2004 > 2012,
Cayman (987) 2005 > 2013



EN

Door Check Strap

Problem

The interior door release handle has become weak, unresponsive and floppy in operation or does not retract to its rest position. A rattling noise can also be heard coming from the door area.

Cause

This door check strap - also known as a door lock pivot lever or interior door pull handle support - is located inside the door interior panel.

Being a highly used component that operates and flexes every time the door is opened, over time the plastic supports which restrain the spring weaken and break, resulting in the symptoms listed above.

Solution

Remove the interior door panel on the affected side. Undo the three T20 screws that retain the component to the door panel and inspect. Replace with febi part 193068 or 193076, check the operation of the door release handle, then refit the interior door trim panel. This will restore the interior door handle to being fully functional again.

For more technical information please visit: partsfinder.bilsteingroup.com