

**Weak performance of turbocharger and whistling noises right after installation!**

When installing this turbocharger please have a closer look at the gasket between exhaust manifold and turbocharger!

This gasket can easily be placed in the wrong direction, see picture and image with dotted line. This will lead to instant drop in performance and whistling noises.



**Vehicle Manufacturer:** Renault, Nissan, Volvo, Mitsubishi

**Engine Code:** S40I, V40, Carisma, Laguna, Megane, Espace, Primera

**Validity:**

This service information is valid for the exchange of the turbocharger with **BTS reference** T912130 / T931121ABS, **manufacturer part no.:** 708639-0002, 708639-0003, 708639-0004, 708639-0005, 708639-0006, 708639-0007, 708639-0008, 708639-0010 (GARRETT); **OE-no.:** 7701474960, 7711135749, 7711368748, 8602478, 7701477263, 7701473526, 7711135336, 8200332125, 8200256077, 8200110519, 8200110519A, 7701472775, 8200369581, 8200381645, 36002419, 8200683855, 14411-AW301, 14411-00Q0E, 1441100Q0K, 8602254, 8602872, 8603688, 36000721, 7701478024

**Please note:**

**OE-references are only for means of comparison.**

**The content of this Service Information is non-binding and is only for informational purposes.**

**The manufacturer specifications have to be adhered to.**