

febi 22044, 39076



To Fit:
Various Volkswagen group vehicles



Tie Rod End

Problem

Knocking or creaking noises may be heard from the front suspension area while driving.

Cause

The original design of this tie rod end is highly susceptible to wear. This is due to insufficient material dimensions; the wear is accelerated when the vehicle is driven in harsh road and weather conditions.



For more technical information please visit: partsfinder.bilsteingroup.com

febi 22044, 39076



To Fit:
Various Volkswagen group vehicles



Solution

febi recommends the use of the tie rod end 22044, which has the following improved features:


- Larger diameter to increase the load carrying capacity
- Stronger body
- Snap ring is replaced by a flange to protect the rubber boot

With this new design, the rubber remains in the housing to ensure a comfortable driving experience and to prevent high-frequency vibrations being transferred to other parts.



Attention!

When replacing this part, please follow the vehicle manufacturer's installation instructions, including the use of any recommended tools.

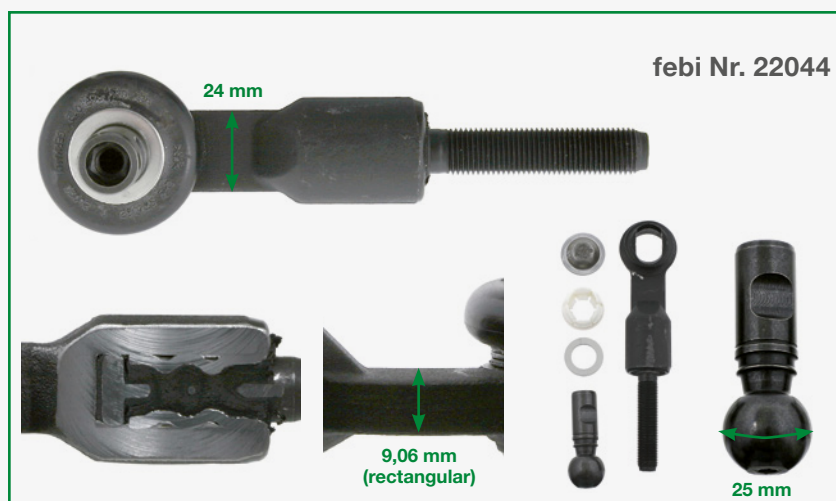

For more technical information please visit: partsfinder.bilsteingroup.com