

Service Info

Tensioning arm 534 0325 10

Improved markings

Manufacturers:	Dodge, Mitsubishi
Model:	
Dodge:	Caliber
Mitsubishi:	ASX
	Lancer
Engines:	
Dodge:	1.8, 2.0, 2.4, 2.4 Turbo
Mitsubishi:	1.8
Part no.:	534 0325 10
OE number:	
Dodge:	04891976AC (replaced)
	04891595AD (new)
Mitsubishi:	1345A059 (replaced)
	1345A079 (new)



Image 1: Tensioning arm 534 0325 10 – Left, old version with fixing screws. Right, new version with fixing screws.



Image 2: Modified markings for the working area of the tensioning arm.

As part of our continuous efforts to improve our products, changes have been made to the tensioning arm 534 0325 10.

The working area markings (A1/A2, image 2) on the housing of the new tensioning arm have been made clearer and longer.

This clarity makes it easier to check that the V-ribbed belt is correctly tensioned when the tensioning arm is installed.

When the V-ribbed belt is fitted and the locking pin is removed, the marking on the lever (M, image 2) must be in the area of the nominal position (N, image 2). When the engine is running, the marking on the lever moves between A1 and A2 in the working area (image 2).

Please note that the fixing screws supplied are shorter to match the thinner mounting flange.

Issued 09.2013 **INA 0117** Technical content subject to change
Listed OE-numbers are for comparison purposes only
© 2013 Schaeffler Automotive Aftermarket

SCHAEFFLER
AUTOMOTIVE AFTERMARKET

In addition, the attachment points for the new version are 10 mm narrower compared to the old points. In the modified version, the width of the attachment points is 12 mm (image 3, right); in the old version, this was 22 mm (image 3, left).

As a result of the modified attachment point dimensions, the length of the fixing screws has also changed. The M8x40 mm screws from the old version can no longer be used with the modified tensioning arm. They must be replaced with the M8x30 mm screws provided (image 4).

It is essential that the screws provided are used when installing the modified tensioning arm.

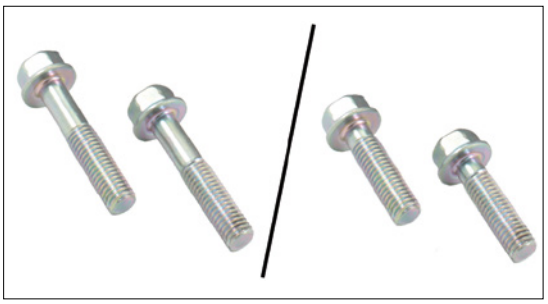


Image 4: Left, old M8x40 mm screws.
Right, new M8x30 mm screws.



Image 3: Left, old version with wide attachment points.
Right, new version with narrow attachment points.

Observe the specifications of the vehicle manufacturer!

Spare parts and technical information can be found under **www.schaeffler-aftermarket.com** or **www.RepXpert.com.**

Phone: +44 (0) 14 32 264 264*
Fax: +44 (0) 14 32 375 760
hfd-info@schaeffler.com
www.schaeffler-aftermarket.com
* Calls from within the UK 08457 001100

SCHAEFFLER
AUTOMOTIVE AFTERMARKET

LUK INA FAG