

febi 199055

To fit: Jaguar XE (X760),
Land Rover Discovery Sport (L550),
Range Rover Evoque (L551),
Range Rover Sport (L494)



Gear Shift Gate / Parking Brake Actuation Repair Kit

Problem

Unable to select gear, vehicle stuck in park.

Cause

The gear shift release trigger button mechanism breaks internally. Therefore, the transmission control switch is unable to communicate with the transmission control module and other system modules to select a gear.

Solution

febi Gear Shift Gate / Parking Brake Actuation Repair Kit 199055 contains all the components included to resolve this fault.

Before starting this repair, it is advised to wear the electro-static discharge gloves supplied.

Ensure the ignition is switched off. Then, use the tool provided to release the adhesive to remove the decal on the gear shift. (Fig. 1)

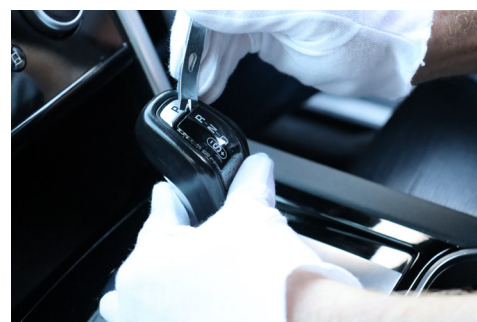


Fig. 1

Remove the screw and release the outer bezel. (Fig. 2)



Fig. 2

Push the release trigger button through the gear shift lever, then unclip the wiring harness. (Fig. 3)

Install the new switch assembly and bezel into the gear shift and tighten with the new screw. Test operation of the gear shift. Check the operation of the trigger and the gear shift module functionality, making sure all gear positions can be selected: Drive, Neutral, Reverse and Sport. Remove the adhesive backing strip and install the new decal, ensuring it is correctly aligned. (Fig. 4)

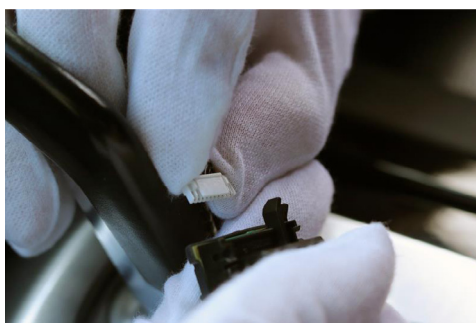


Fig. 3



Fig. 4

Check all control units with a suitable diagnostic tool for any fault codes related to this repair and clear as necessary.

For more technical information please visit: partsfinder.bilsteingroup.com