



## INA Service Info



# Tensioner pulleys 531 0535 20 and 531 0819 10

## Risk of mix-ups

Manufacturer: Honda, Opel, Vauxhall

**Models:**

Honda: Civic  
 Opel: Astra G, Astra H, Combo, Corsa B, Corsa C, Corsa D, Meriva, Zafira  
 Vauxhall: Astra Mk IV, Astra Mk V, Combo, Corsa Mk II, Meriva

Engines: 1.7 DI, 1.7 DTI, 1.7 CDTI

Part no.: 531 0535 20  
 531 0819 10

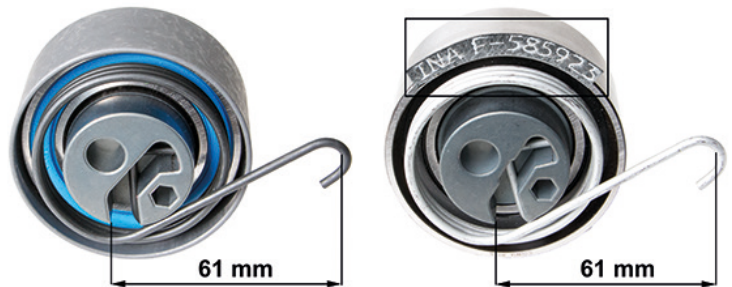


Fig. 1: 531 0535 20 – Old design (left), new design (right)

For current listing refer to catalogue media

Tensioner pulleys 531 0535 20 and 531 0819 10 are replaced by a new design, whereby the part numbers have not changed. The modifications make it easier to distinguish the two types from one another.

The clearest distinguishing characteristic is the product number printed on the part and the colour of the spring steel (Fig. 1 and Fig. 2).

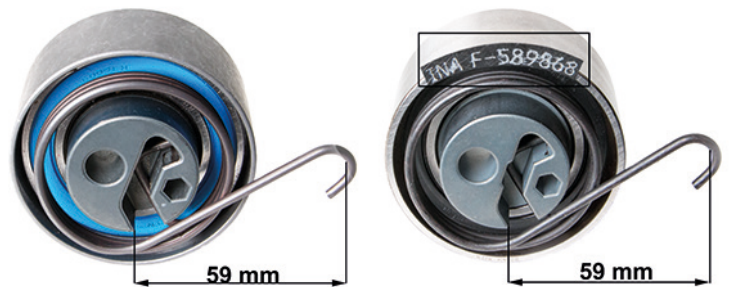


Fig. 2: 531 0819 10 – Old design (left), new design (right)

Part number	Product number
531 0535 20	F-585923
531 0819 10	F-589868

The new designs also feature track rollers with a ground surface and the spring steel used is corrosion resistant.

Due to the similarity of the two types of tensioner rollers, extreme care must be taken to associate the correct part number to the corresponding vehicle. Installing the wrong tensioner can damage the engine!

Please observe the vehicle manufacturer specifications!

**You want more? We can help!**

Phone: +44 (0) 1432 264 264  
 Fax: +44 (0) 1432 375 760  
 aftermarket.uk@schaeffler.com  
 www.repxpert.co.uk